



Date:	October 10, 2016	Aircraft:	KING AIR B200
Company:	GOBIERNO DEL ESTADO DE	Registration:	XC-CLQ
Contact:	ALBERTO SANTANA	Serial:	BB-1958
Phone:	59370521312300	Quoted By:	Carlos S. Orrego
Email:	SANTANA_ALBERTO@HOTMAIL.COM	Proposal ID:	13088
		Work Order:	050/37665/39416

WORK SCOPE

Banyan Air Services is pleased to provide this itemized proposal for your review. If this proposal fails to meet your expectations for any reason, please contact Carlos Orrego at 954-492-3567 or email: corrego@banyanair.com

PHASE 1-4, BORESCOPE

Item	Description	Service	Amount
1	COMPLY WITH PHASE 1 THROUGH 4 INSPECTION. <i>Note: To comply with 200 hour lubrication.</i> <i>This item is: Mandatory</i>	Labor: Parts: Total:	\$9,775.00 \$950.00 \$10,725.00
2	COMPLY WITH 200 HOUR LUBRICATION REQUIREMENTS. <i>This item is: Mandatory</i>	Total:	\$0.00
3	COMPLY WITH LIGHTING STRIKE INSPECTION (EVIDENCE OF ARCING ON LEFT PROPELLER). <i>Note: To inspect and advise only.</i> <i>This item is: Mandatory</i>	Labor: Total:	\$1,140.00 \$1,140.00
4	WING ICE LIGHT INOPERATIVE. <i>Note: To remove and replace bulb.</i> <i>This item is: Mandatory</i>	Labor: Parts: Total:	\$114.00 \$75.00 \$189.00
5	TROUBLESHOOT HOT PLATE NOT WORKING WITH GALLEY ENERGIZED. <i>Note: Rechecked system and found to be operating normally.</i> <i>This item is: Mandatory</i>	Total:	\$0.00
6	TROUBLESHOOT LAVATORY WILL NOT FLUSH (PUMP NOT WORKING). <i>Note: To troubleshoot and repair broken wire.</i> <i>This item is: Mandatory</i>	Labor: Total:	\$342.00 \$342.00
7	TROUBLESHOOT RIGHT FUEL GAGE DOES NOT READ FULL WHEN TOPPED OFF. <i>Note: See status report for details.</i> <i>This item is: Mandatory</i>	Labor: Parts: Total:	\$1,710.00 \$3,487.00 \$5,197.00



Work Order Quote

Date:	October 10, 2016	Aircraft:	KING AIR B200
Company:	GOBIERNO DEL ESTADO DE	Registration:	XC-CLQ
Contact:	ALBERTO SANTANA	Serial:	BB-1958
Phone:	59370521312300	Quoted By:	Carlos S. Orrego
Email:	SANTANA_ALBERTO@HOTMAIL.COM	Proposal ID:	13088
		Work Order:	050/37665/39416

Item	Description	Service	Amount
8	ALL POLARIZED WINDOWS BROWNE <i>Note: To remove and replace polarizers. This item is: Recommended</i>	Labor: Parts: Total:	\$912.00 \$8,448.00 \$9,360.00
9	TROUBLESHOOT FORWARD EVAPORATOR FAN DOES NOT WORK IN LOW OR HIGH. <i>Note: To troubleshoot, remove and replace blower/speed control and pressurize. See item #998 for core deposit. This item is: Mandatory</i>	Labor: Parts: Total:	\$1,140.00 \$2,545.00 \$3,685.00
10	TROUBLESHOOT AIR CONDITIONING SYSTEM DOES NOT COOL. <i>Note: To troubleshoot and advise only. This item is: Mandatory</i>	Labor: Total:	\$228.00 \$228.00
11	TROUBLESHOOT WING ICE LIGHT DOES NOT ILLUMINATE. <i>Note: To troubleshoot and advise only. Duplicate #4. This item is: Mandatory</i>	Total:	\$0.00
12	TROUBLESHOOT LEFT BRAKE DE-ICE DOES NOT OPERATE. <i>Note: See status report for details. Core deposit on #998. This item is: Mandatory</i>	Labor: Parts: Total:	\$228.00 \$585.00 \$813.00
13	TOP OF AIRCRAFT WITH FUEL FOR LEAK CHECK. <i>This item is: Mandatory</i>	Outside: Total:	\$600.00 \$600.00
14	DEFUEL AIRCRAFT PRIOR TO INSPECTION. <i>This item is: Mandatory</i>	Labor: Total:	\$456.00 \$456.00
15	BOTH SQUAT SWITCH NEEDS ADJUSTMENT. <i>Note: To adjust both squat switches. This item is: Mandatory</i>	Labor: Total:	\$342.00 \$342.00
16	FOUND WASP NEST ON RIGHT OUTFLOW VALVE AND INSIDE DUCT. <i>Note: To remove wasp nest. This item is: Mandatory</i>	Labor: Total:	\$171.00 \$171.00



Work Order Quote

Date:	October 10, 2016	Aircraft:	KING AIR B200
Company:	GOBIERNO DEL ESTADO DE	Registration:	XC-CLQ
Contact:	ALBERTO SANTANA	Serial:	BB-1958
Phone:	59370521312300	Quoted By:	Carlos S. Orrego
Email:	SANTANA_ALBERTO@HOTMAIL.COM	Proposal ID:	13088
		Work Order:	050/37665/39416

Item	Description	Service	Amount
17	<p>TROUBLESHOOT RIGHT NO. 2 AND LEFT NO. 3 CABIN SEATS LATERAL (SIDE TO SIDE) MOVEMENT ONLY LOCK IN PLACE WITH HANDLE FORCED INTO STOWED POSITION.</p> <p><i>Note: Part pricing is to be determined.</i></p> <p><i>This item is: Mandatory</i></p>	<p>Labor:</p> <p>Total:</p>	<p>\$684.00</p> <p>\$684.00</p>
18	<p>EFT NO. 1, NO. 3 AND RIGHT NO. 3 CABIN SEATS ARE MISSING THE SHOULDER HARNESS PLACARD.</p> <p><i>Note: To install missing placards.</i></p> <p><i>This item is: Mandatory</i></p>	<p>Parts:</p> <p>Total:</p>	<p>\$107.00</p> <p>\$107.00</p>
19	<p>FIRST AID KIT NEXT INSPECTION DUE OCTOBER 2016.</p> <p><i>Note: To remove and replace first aid kit.</i></p> <p><i>This item is: Mandatory</i></p>	<p>Parts:</p> <p>Total:</p>	<p>\$250.00</p> <p>\$250.00</p>
20	<p>LEFT AFT DIVIDER ADJUSTABLE FEET ARE CORRODED OFF OF THE ATTACHING STUDS.</p> <p><i>Note: To extract stud and installed new mounting foot.</i></p> <p><i>This item is: Mandatory</i></p>	<p>Labor:</p> <p>Parts:</p> <p>Total:</p>	<p>\$228.00</p> <p>\$1,365.00</p> <p>\$1,593.00</p>
21	<p>LEFT OUTBOARD WING CUFF SEAL COMING LOOSE.</p> <p><i>Note: To reglue and secure.</i></p> <p><i>This item is: Mandatory</i></p>	<p>Total:</p>	<p>\$0.00</p>
22	<p>LEFT AND RIGHT OUTBOARD WINGS UPPER INSPECTION BOLT ACCESS PANELS ARE SPEED TAPED ON THE AIRCRAFT.</p> <p><i>Note: To readjust and install.</i></p> <p><i>This item is: Mandatory</i></p>	<p>Total:</p>	<p>\$0.00</p>
23	<p>RIGHT NO. 1, NO. 2 AND LEFT NO. 2, NO. 3 CABIN SEAT, SEAT SKIRTS HAVE LOOSE AND/OR MISSING VELCRO.</p> <p><i>Note: To install Velcro. Parts are as required.</i></p> <p><i>This item is: Recommended</i></p>	<p>Labor:</p> <p>Total:</p>	<p>\$85.50</p> <p>\$85.50</p>
24	<p>TOILET SEATBELT WHEN ACTUATED DOES NOT ALWAYS LOCK.</p> <p><i>Note: To send out for repair or replace.</i></p> <p><i>This item is: Mandatory</i></p>	<p>Labor:</p> <p>Parts:</p> <p>Total:</p>	<p>\$228.00</p> <p>\$450.00</p> <p>\$678.00</p>



Work Order Quote

Date:	October 10, 2016	Aircraft:	KING AIR B200
Company:	GOBIERNO DEL ESTADO DE	Registration:	XC-CLQ
Contact:	ALBERTO SANTANA	Serial:	BB-1958
Phone:	59370521312300	Quoted By:	Carlos S. Orrego
Email:	SANTANA_ALBERTO@HOTMAIL.COM	Proposal ID:	13088
		Work Order:	050/37665/39416

Item	Description	Service	Amount
25	DIVIDER IN THE MAGAZINE DRAWER, ATTACHED TO THE RIGHT AFT FORWARD DIVIDER, IS LOOSE. <i>Note: To resecure.</i> <i>This item is: Recommended</i>	Labor: Total:	\$171.00 \$171.00
26	AFT CURTAIN DIVIDER HAS THREE BROKEN SECURING CLIPS. <i>Note: To replace clips. Part cost to be determined.</i> <i>This item is: Recommended</i>	Total:	\$0.00
27	LEFT NACELLE AND AUXILIARY TANKS HAVE METAL SHAVINGS (DEBRIS). <i>Note: To gain access, clean and reinstall.</i> <i>This item is: Mandatory</i>	Labor: Parts: Total:	\$570.00 \$165.00 \$735.00
28	RIGHT NACELLE AND AUXILIARY TANKS HAVE METAL SHAVINGS (DEBRIS). <i>Note: To gain access, clean and reinstall.</i> <i>This item is: Mandatory</i>	Labor: Parts: Total:	\$570.00 \$165.00 \$735.00
29	FOUND ONE BAD STATIC WICK ON EACH WING. <i>Note: To remove, replace static wick and test.</i> <i>This item is: Mandatory</i>	Labor: Parts: Total:	\$171.00 \$138.00 \$309.00
30	RIGHT INBOARD FLAP CHAFFING IN TWO SPOTS. <i>Note: To evaluate and advise only.</i> <i>This item is: Mandatory</i>	Labor: Total:	\$342.00 \$342.00
31	COPILOT'S WINDSHIELD AND TWO SIDE WINDOWS HAVE PAINT OVERSPRAY ON THEM. <i>Note: Option to polish all windows \$1,950.00.</i> <i>This item is: Mandatory</i>	Outside: Total:	\$790.00 \$790.00
32	ELEVATOR TRIM CABLE TENSION LOW. <i>Note: To adjust tension.</i> <i>This item is: Mandatory</i>	Labor: Total:	\$342.00 \$342.00
33	PHENOLIC CABLE GUARD IN LEFT WING AILERON TRIM CABLE IS BROKEN. <i>This item is: Mandatory</i>	Labor: Parts: Total:	\$114.00 \$162.00 \$276.00



Work Order Quote

Date:	October 10, 2016	Aircraft:	KING AIR B200
Company:	GOBIERNO DEL ESTADO DE	Registration:	XC-CLQ
Contact:	ALBERTO SANTANA	Serial:	BB-1958
Phone:	59370521312300	Quoted By:	Carlos S. Orrego
Email:	SANTANA_ALBERTO@HOTMAIL.COM	Proposal ID:	13088
		Work Order:	050/37665/39416

Item	Description	Service	Amount
34	ELEVATOR CABLE TENSION IS HIGH. <i>Note: To adjust cable tension.</i> <i>This item is: Mandatory</i>	Labor: Total:	\$456.00 \$456.00
35	COMPLY WITH RAISBECK ENGINEERING DUAL AFT BODY STRAKES PHASE 1 THROUGH 4 INSPECTIONS. <i>Note: To inspect per ICA.</i> <i>This item is: Mandatory</i>	Labor: Total:	\$228.00 \$228.00
36	COMPLY WITH "CONTINUOUS CORROSION CONTROL" INSPECTION. <i>Note: In conjunction with complete inspection.</i> <i>This item is: Mandatory</i>	Total:	\$0.00
37	COMPLY WITH "OPERATING IN AREAS OF HIGH HUMIDITY" INSPECTION. <i>Note: Included.</i> <i>This item is: Mandatory</i>	Total:	\$0.00
38	COMPLY WITH 12 MONTH LIFE RAFT CERTIFICATION. <i>Note: Estimate only. No life raft found on board.</i> <i>This item is: Recommended</i>	Parts: Total:	\$950.00 \$950.00
39	COMPLY WITH LIFE VEST INSPECTION. <i>This item is: Recommended</i>	Labor: Total:	\$114.00 \$114.00
40	COMPLY WITH 1200 HOUR PEDESTAL POWER LEVER STOP PIN INSPECTION. DUE IN 117 HOURS. <i>Note: To gain access, inspect and close up.</i> <i>This item is: Recommended</i>	Labor: Total:	\$228.00 \$228.00
41	COMPLY WITH 12 MONTH PILOT'S FUEL CONTROL PANEL, LOWER EDGELIGHTED PANEL AND COPILOT'S EDGELIGHTED CIRCUIT BREAKER PANEL AND OTHER CIRCUITRY BELOW STORM WINDOWS INSPECTION. DUE: OCT 2015. <i>Note: To remove batter, charged, capacity check, recharge and reinstalled.</i> <i>This item is: Mandatory</i>	Labor: Total:	\$456.00 \$456.00



Work Order Quote

Date:	October 10, 2016	Aircraft:	KING AIR B200
Company:	GOBIERNO DEL ESTADO DE	Registration:	XC-CLQ
Contact:	ALBERTO SANTANA	Serial:	BB-1958
Phone:	59370521312300	Quoted By:	Carlos S. Orrego
Email:	SANTANA_ALBERTO@HOTMAIL.COM	Proposal ID:	13088
		Work Order:	050/37665/39416

Item	Description	Service	Amount
42	<p>COMPLY WITH 12 MONTH / 200 HOUR MAIN BATTERY CAPACITY TEST. DUE: OCT 2016. <i>Note: To remove battery, charge, perform capacity check, recharge and reinstall.</i></p> <p><i>This item is: Mandatory</i></p>	<p>Labor:</p> <p>Total:</p>	<p>\$456.00</p> <p>\$456.00</p>
43	<p>COMPLY WITH 12 MONTH CABIN ALTITUDE WARNING PRESSURE SWITCH TEST. DUE: OCT 2016. <i>Note: To comply with 12 month cabin altitude pressure switch test.</i></p> <p><i>This item is: Mandatory</i></p>	<p>Labor:</p> <p>Total:</p>	<p>\$342.00</p> <p>\$342.00</p>
44	<p>COMPLY WITH 12 MONTH OXYGEN SYSTEM PRESSURE SWITCH TEST. DUE: OCT 2016. <i>Note: To comply with oxygen barometric pressure check.</i></p> <p><i>This item is: Mandatory</i></p>	<p>Labor:</p> <p>Total:</p>	<p>\$342.00</p> <p>\$342.00</p>
45	<p>COMPLY WITH 36 MONTH PASSENGER OXYGEN CYLINDER HYDROSTATIC TEST. (REGULATOR OVERHAUL). OVERDUE. <i>Note: To remove and replace oxygen cylinder and leak check.</i></p> <p><i>This item is: Mandatory</i></p>	<p>Labor:</p> <p>Parts:</p> <p>Total:</p>	<p>\$570.00</p> <p>\$995.00</p> <p>\$1,565.00</p>
46	<p>COMPLY WITH 12 MONT COCKPIT AND CABIN PORTABLE FIRE EXTINGUISHER INSPECTION/WEIGHT CHECK. DUE: OCT 2016. <i>Note: To weight check both fire bottles.</i></p> <p><i>This item is: Mandatory</i></p>	<p>Labor:</p> <p>Total:</p>	<p>\$114.00</p> <p>\$114.00</p>
47	<p>COMPLY WITH 24 MONTH NOSE WHEEL CORROSION INSPECTION. OVERDUE. <i>Note: To disassemble, inspect and reassembled.</i></p> <p><i>This item is: Mandatory</i></p>	<p>Labor:</p> <p>Total:</p>	<p>\$342.00</p> <p>\$342.00</p>
48	<p>COMPLY WITH 6 YEAR / 8000 CYCLE LEFT, RIGHT AND NOSE LANDING GEAR DRAG BRACE ASSEMBLY INSPECTION. NO RECORD OF COMPLIANCE DURING GEAR INSPECTION ON DEC 11, 2012 AT 1620.3 TT. <i>Note: To remove, disassemble, clean, inspect, reassemble, reinstall and swing gear. Parts are as required.</i></p> <p><i>This item is: Mandatory</i></p>	<p>Labor:</p> <p>Total:</p>	<p>\$1,140.00</p> <p>\$1,140.00</p>



Work Order Quote

Date:	October 10, 2016	Aircraft:	KING AIR B200
Company:	GOBIERNO DEL ESTADO DE	Registration:	XC-CLQ
Contact:	ALBERTO SANTANA	Serial:	BB-1958
Phone:	59370521312300	Quoted By:	Carlos S. Orrego
Email:	SANTANA_ALBERTO@HOTMAIL.COM	Proposal ID:	13088
		Work Order:	050/37665/39416

Item	Description	Service	Amount
49	<p>COMPLY WITH 6 YEAR / 8000 CYCLE LEFT, RIGHT AND NOSE LANDING GEAR TRUNNION BOLT HOLES AND DRAG BRACE ATTACH HOLES INSPECTION. NO RECORD OF COMPLIANCE DURING GEAR INSPECTION ON DEC 11, 2012 AT 16203 TT.</p> <p><i>Note: To remove , measure, reinstall and swing gear. Parts are as required.</i></p> <p><i>This item is: Mandatory</i></p>	<p>Labor:</p> <p>Total:</p>	<p>\$2,736.00</p> <p>\$2,736.00</p>
50	<p>COMPLY WITH 12 MONTH OUTBOARD WING PANEL UPPER AND LOWER MAIN SPAR CAP INSPECTION.</p> <p><i>Note: To inspect upper and lower spar cap.</i></p> <p><i>This item is: Mandatory</i></p>	<p>Labor:</p> <p>Total:</p>	<p>\$228.00</p> <p>\$228.00</p>
51	<p>COMPLY WITH 60 MONTH WING ATTACH FITTING FLAT SURFACES DEPRESSIONS, COUNTERBORES, BOLTS BORES INSPECTION AT THE UPPER FORWARD, UPPER AND LOWER AFT WING JOINTS.</p> <p><i>Note: To remove and reinstall bolts after inspection.</i></p> <p><i>This item is: Mandatory</i></p>	<p>Labor:</p> <p>Total:</p>	<p>\$2,850.00</p> <p>\$2,850.00</p>
52	<p>COMPLY WITH 60 MONTH UPPER FORWARD, UPPER AND LOWER AFT WING BOLT AND NUTS PENETRANT INSPECTION. OVERDUE.</p> <p><i>Note: Labor at no charge if accomplished during item 51.</i></p> <p><i>This item is: Mandatory</i></p>	<p>Total:</p>	<p>\$0.00</p>
53	<p>COMPLY WITH 60 MONTH LOWER FORWARD MAIN SPAR CLEVIS FITTING INSPECTION. OVERDUE.</p> <p><i>This item is: Mandatory</i></p>	<p>Labor:</p> <p>Parts:</p> <p>Total:</p>	<p>\$456.00</p> <p>\$129.00</p> <p>\$585.00</p>
54	<p>COMPLY WITH 60 MONTH LOWER FORWARD WING BOLT AND NUT REPLACEMENT. OVERDUE.</p> <p><i>Note: To remove/replace bolt and nut.</i></p> <p><i>This item is: Mandatory</i></p>	<p>Labor:</p> <p>Parts:</p> <p>Total:</p>	<p>\$342.00</p> <p>\$129.00</p> <p>\$471.00</p>
55	<p>COMPLY WITH 60 MONTH LEFT AND RIGHT ENGINE FIRE EXTINGUISHER HYDROSTATIC TEST.</p> <p><i>Note: To remove and reinstall both engine fire extinguishers.</i></p> <p><i>This item is: Mandatory</i></p>	<p>Labor:</p> <p>Parts:</p> <p>Total:</p>	<p>\$912.00</p> <p>\$1,500.00</p> <p>\$2,412.00</p>



Work Order Quote

Date:	October 10, 2016	Aircraft:	KING AIR B200
Company:	GOBIERNO DEL ESTADO DE	Registration:	XC-CLQ
Contact:	ALBERTO SANTANA	Serial:	BB-1958
Phone:	59370521312300	Quoted By:	Carlos S. Orrego
Email:	SANTANA_ALBERTO@HOTMAIL.COM	Proposal ID:	13088
		Work Order:	050/37665/39416

Item	Description	Service	Amount
56	COMPLY WITH 18 MONTH / 600 HOUR WING CENTER SECTION UPPER SURFACE BONDED PANEL INSPECTION. DUE: APRIL 2017. <i>Note: To comply with bonded panel inspection.</i> <i>This item is: Recommended</i>	Labor: Total:	\$342.00 \$342.00
57	COMPLY WITH 800 HOUR / 24 MONTH LUBRICATION REQUIREMENT. OVERDUE. <i>Note: To comply with 800 hour / 24 month lubrication.</i> <i>This item is: Mandatory</i>	Labor: Total:	\$342.00 \$342.00
58	COMPLY WITH 1200 HOUR LUBRICATION REQUIREMENTS. DUE IN 117 HOURS. <i>Note: To comply with 1200 hour lubrication.</i> <i>This item is: Recommended</i>	Labor: Total:	\$1,824.00 \$1,824.00
59	COMPLY WITH 12 MONTH WING BOLT LUBRICATION. DUE: OCT 2016. <i>Note: To comply with lubrication of left and right wing bolt.</i> <i>This item is: Mandatory</i>	Labor: Total:	\$171.00 \$171.00
60	COMPLY WITH LEFT AND RIGHT STARTER GENERATOR QAD ATTACHMENT FLANGE INSPECTION. NO RECORD OF COMPLIANCE AT LAST OVERHAULED ON FEB 6, 2014 AT 1884.4 TT. <i>This item is: Mandatory</i>	Labor: Total:	\$456.00 \$456.00
61	COMPLY WITH 1200 HOUR / 1000 CYCLE LANDING GEAR HYDRAULIC SYSTEM FILTER AND O-RING REPLACEMENT. NO RECORD OF COMPLIANCE. <i>Note: To remove, inspect, replace, reservice and swing gear.</i> <i>This item is: Mandatory</i>	Labor: Parts: Total:	\$342.00 \$230.00 \$572.00
62	COMPLY WITH 10 YEAR LANDING GEAR HYDRAULIC SYSTEM TEFLON HOSE REPLACEMENT. DUE: OCT 2016. <i>Note: To remove and replace hoses and leak check.</i> <i>This item is: Mandatory</i>	Labor: Parts: Total:	\$1,368.00 \$1,800.00 \$3,168.00



Work Order Quote

Date:	October 10, 2016	Aircraft:	KING AIR B200
Company:	GOBIERNO DEL ESTADO DE	Registration:	XC-CLQ
Contact:	ALBERTO SANTANA	Serial:	BB-1958
Phone:	59370521312300	Quoted By:	Carlos S. Orrego
Email:	SANTANA_ALBERTO@HOTMAIL.COM	Proposal ID:	13088
		Work Order:	050/37665/39416

Item	Description	Service	Amount
63	<p>COMPLY WITH 60 MONTH LEFT AND RIGHT MAIN LANDING GEAR BRAKE HOSES (WHEEL WELL) REPLACEMENT. OVERDUE. <i>Note: To remove and replace left and right brake hoses and bleed brakes.</i></p> <p><i>This item is: Mandatory</i></p>	<p>Labor: \$912.00 Parts: \$590.00 Total: \$1,502.00</p>	
64	<p>COMPLY WITH 12 MONTH EMERGENCY EXIT SIGN (SELF-ILLUMINATING) BRIGHTNESS LEVEL TEST. DUE: OCT 2016. <i>Note: To inspect.</i></p> <p><i>This item is: Mandatory</i></p>	<p>Labor: \$114.00 Total: \$114.00</p>	
65	<p>COMPLY WITH 60 MONTH LEFT AND RIGHT ENGINE FLAMMABLE LIQUID CARRYING HOSES REPLACEMENT. OVERDUE. <i>Note: To remove and replace hoses.</i></p> <p><i>This item is: Mandatory</i></p>	<p>Labor: \$1,824.00 Parts: \$6,200.00 Total: \$8,024.00</p>	
66	<p>COMPLY WITH 12 MONTH HORIZONTAL AND VERTICAL STABILIZER RECURRING INSPECTION. DUE: OCT 2016. <i>Note: To remove and reinstall panels after inspection.</i></p> <p><i>This item is: Mandatory</i></p>	<p>Labor: \$912.00 Total: \$912.00</p>	
67	<p>COMPLY WITH RECURRING MANDATORY SERVICE BULLETIN 27-34-59 FLIGHT CONTROL GUST LOCK INSPECTION/REPLACEMENT. <i>Note: To inspect flight control gust lock.</i></p> <p><i>This item is: Recommended</i></p>	<p>Labor: \$114.00 Total: \$114.00</p>	
68	<p>COMPLY WITH AD 2016-11-20 B/E AEROSPACE PROTECTIVE BREATHING EQUIPMENT P/N: 119003-11. <i>Note: To inspect as per ICA.</i></p> <p><i>This item is: Mandatory</i></p>	<p>Labor: \$85.00 Total: \$85.00</p>	
69	<p>COMPLY WITH 12 MONTH ICA FOR BLR WINGLET INSTALLATION. OVERDUE. <i>Note: To inspect as per ICA.</i></p> <p><i>This item is: Mandatory</i></p>	<p>Labor: \$171.00 Total: \$171.00</p>	



Work Order Quote

Date:	October 10, 2016	Aircraft:	KING AIR B200
Company:	GOBIERNO DEL ESTADO DE	Registration:	XC-CLQ
Contact:	ALBERTO SANTANA	Serial:	BB-1958
Phone:	59370521312300	Quoted By:	Carlos S. Orrego
Email:	SANTANA_ALBERTO@HOTMAIL.COM	Proposal ID:	13088
		Work Order:	050/37665/39416

Item	Description	Service	Amount
70	FLIGHT MANUAL REQUIRED REVISION A5 DATED MARCH 2007. <i>This item is: Mandatory</i>	Total:	\$0.00
71	LEFT FORWARD PARTITION HAS ONE SEAT TACK ADAPTER BROKEN OFF. <i>Note: To install seat track adapter.</i> <i>This item is: Mandatory</i>	Labor: Parts: Total:	\$171.00 \$1,365.00 \$1,536.00
72	PILOT SEAT OUTBOARD FORE/AFT ADJUST CABLE CLEVIS PIN SHEARED OFF. <i>Note: To remove and replace pin.</i> <i>This item is: Mandatory</i>	Labor: Parts: Total:	\$171.00 \$8.50 \$179.50
73	PRESSURIZATION SAFETY VALVE TEST PORT LINE IS KINKED. <i>Note: To reposition and lengthen line.</i> <i>This item is: Mandatory</i>	Labor: Total:	\$228.00 \$228.00
74	#2 AND #4 WHEEL ASSEMBLIES INCORRECTLY ASSEMBLED. <i>Note: To remove, disassembled and reassemble correctly.</i> <i>This item is: Mandatory</i>	Labor: Parts: Total:	\$684.00 \$69.00 \$753.00
800	INSPECTION / RESEARCH <i>This item is: Mandatory</i>	Total:	\$0.00
996	COMPLY WITH PRE-DELIVERY CHECK LIST	Total:	\$0.00
997	SHOP SUPPLIES	Parts: Total:	\$1,987.22 \$1,987.22
998	CORE CHARGES/CREDITS <i>Note:</i> #9 Blower Assembly \$1500.00 #9 Speed Controller \$3000.00 #12 Shut Off Valve Assembly \$ 950.00 #1002 Overspeed Governor \$4600.00 #1002 Primary Governor \$4400.00 <i>This item is: Mandatory</i>	Parts: Total:	\$14,450.00 \$14,450.00



Work Order Quote

Date:	October 10, 2016	Aircraft:	KING AIR B200
Company:	GOBIERNO DEL ESTADO DE	Registration:	XC-CLQ
Contact:	ALBERTO SANTANA	Serial:	BB-1958
Phone:	59370521312300	Quoted By:	Carlos S. Orrego
Email:	SANTANA_ALBERTO@HOTMAIL.COM	Proposal ID:	13088
		Work Order:	050/37665/39416

Item	Description	Service	Amount
1001	PERFORM BORESCOPE INSPECTION ON BOTH ENGINES. <i>This item is: Mandatory</i>	Labor: Total:	\$1,368.00 \$1,368.00
1002	COMPLY WITH LIGHTING STRIKE INSPECTION (EVIDENCE OF ARCING BURN ON LEFT PROPELLER). <i>Note: To remove, install with either overhauled/new primary/overspeed governor.</i> <i>This item is: Mandatory</i>	Labor: Parts: Total:	\$684.00 \$5,650.00 \$6,334.00
1003	COMPLY WITH PRATT & WHITNEY CANADA PERIODIC ROUTINE AND MINOR INSPECTIONS (LEFT AND RIGHT ENGINES). <i>Note: Included in phase 1-4.</i> <i>This item is: Mandatory</i>	Total:	\$0.00
1004	COMPLY WITH 12 MONTH / 400 HOUR LEFT AND RIGHT PROPELLER LUBRICATION. DUE: OCT 2016. <i>Note: To comply with lubrication.</i> <i>This item is: Mandatory</i>	Labor: Total:	\$114.00 \$114.00
1005	COMPLY WITH LEFT AND RIGHT PROPELLER DETAILED INSPECTION. DUE: OCT 2016. <i>Note: Included in phase 1-4.</i> <i>This item is: Mandatory</i>	Total:	\$0.00
1006	COMPLY WITH 6 MONTH /200 HOUR LEFT AND RIGHT ENGINE AGB SCAVENGE PUMP INLET SCREEN INSPECTION. OVERDUE. <i>This item is: Mandatory</i>	Labor: Total:	\$228.00 \$228.00
1007	COMPLY WITH LEFT AND RIGHT ENGINE P3 FILTER CLEANING. 200 HOUR. <i>Note: To clean, inspect, reinstall both filters.</i> <i>This item is: Mandatory</i>	Labor: Total:	\$228.00 \$228.00
1008	COMPLY WITH 200 HOUR LEFT AND RIGHT ENGINE P3 FILTER HOUSING POST SB 3350 DRAIN VALVE HOUSING ASSEMBLY CLEAN/INSPECT. OVERDUE. <i>Note: No charge if completed with item 1007.</i> <i>This item is: Mandatory</i>	Total:	\$0.00



Work Order Quote

Date:	October 10, 2016	Aircraft:	KING AIR B200
Company:	GOBIERNO DEL ESTADO DE	Registration:	XC-CLQ
Contact:	ALBERTO SANTANA	Serial:	BB-1958
Phone:	59370521312300	Quoted By:	Carlos S. Orrego
Email:	SANTANA_ALBERTO@HOTMAIL.COM	Proposal ID:	13088
		Work Order:	050/37665/39416

Item	Description	Service	Amount
1009	COMPLY WITH LEFT AND RIGHT ENGINE COMPRESSOR AND COMPRESSOR TURBINE DESALINATION WASH. <i>Note: To accomplish left and right compressor wash.</i> <i>This item is: Mandatory</i>	Labor: Total:	\$912.00 \$912.00
1010	COMPLY WITH 400 HOUR LEFT AND RIGHT ENGINE DECELERATION CHECK. OVERDUE. <i>Note: To accomplish during outgoing runs.</i> <i>This item is: Mandatory</i>	Total:	\$0.00
1011	COMPLY WITH LEFT AND RIGHT ENGINE CHIP DETECTOR CONTINUITY CHECK. DUE: OCT 2016. <i>Note: Included in minor and routine inspection.</i> <i>This item is: Mandatory</i>	Total:	\$0.00
1012	COMPLY WITH 12 MONTH / 600 HOUR LEFT AND RIGHT ENGINE CHIP DETECTOR BRIDGE CHECK. DUE: OCT 2016. <i>Note: Included in minor and routine inspection.</i> <i>This item is: Mandatory</i>	Total:	\$0.00
1013	LEFT ENGINE OIL COOLER COWLING SEAL MISSING IN PLACES. <i>This item is: Mandatory</i>	Labor: Total:	\$684.00 \$684.00
2001	COMPLY WITH 12 MONTH ELT FUNCTIONAL CHECK. DUE: OCT 2016. <i>This item is: Mandatory</i>	Labor: Total:	\$228.00 \$228.00
2002	COMPLY WITH 24 MONTH 91.411, 91.413 REQUIREMENTS. OVERDUE. <i>This item is: Mandatory</i>	Labor: Total:	\$2,400.00 \$2,400.00
2003	COMPLY WITH 24 MONTH ICA FOR STC ST 01278SE GROUP AIRPLANE APPROVAL FOR RVSM. <i>This item is: Mandatory</i>	Labor: Total:	\$570.00 \$570.00



Work Order Quote

Date:	October 10, 2016	Aircraft:	KING AIR B200
Company:	GOBIERNO DEL ESTADO DE	Registration:	XC-CLQ
Contact:	ALBERTO SANTANA	Serial:	BB-1958
Phone:	59370521312300	Quoted By:	Carlos S. Orrego
Email:	SANTANA_ALBERTO@HOTMAIL.COM	Proposal ID:	13088
		Work Order:	050/37665/39416

Item	Description	Service	Amount
2004	COMPLY WITH 24 MONTH CVR ULB OPERATIONAL TEST. OVERDUE. <i>This item is: Mandatory</i>	Labor: Total:	\$456.00 \$456.00
2005	COMPLY WITH 6 MONTH ESIS BATTERY PS835D PERIODIC CHECK. <i>This item is: Mandatory</i>	Labor: Total:	\$456.00 \$456.00
2006	COMPLY WITH 12 MONTH ESIS BATTERY PS835D CAPACITY TEST. DUE: OCT 2016. <i>This item is: Mandatory</i>	Labor: Total:	\$456.00 \$456.00
9992	PRICES QUOTED REPRESENTED A 3% DISCOUNT FOR PAYMENT METHODS OF CASH, CHECK, OR WIRE TRANSFER. THIS DISCOUNT DOES NOT APPLY IF PAYING BY CREDIT CARD.	Total:	\$0.00
Mandatory Totals:		Labor: Parts: Outside: Total:	\$47,600.00 \$45,546.72 \$1,390.00 \$94,536.72
Recommended Totals:		Labor: Parts: Total:	\$3,790.50 \$9,398.00 \$13,188.50
Grand Totals:		Labor: Parts: Outside: Total:	\$51,390.50 \$54,944.72 \$1,390.00 \$107,725.22



Date:	October 10, 2016	Aircraft:	KING AIR B200
Company:	GOBIERNO DEL ESTADO DE	Registration:	XC-CLQ
Contact:	ALBERTO SANTANA	Serial:	BB-1958
Phone:	59370521312300	Quoted By:	Carlos S. Orrego
Email:	SANTANA_ALBERTO@HOTMAIL.COM	Proposal ID:	13088
		Work Order:	050/37665/39416

Banyan's General Terms and Conditions

- Pricing does not include freight charges, applicable sales tax, crew or fuel for any flight-testing, de-fuel or charges incurred due to unforeseen damages.
- Quote/Flat rate pricing does not include repairs on any discrepancies that may be found. Upon arrival of the aircraft, an incoming inspection will be performed; an estimate and quote will be provided for your approval based on our current shop labor rate at the time of service per hour.
- Quote is valid for 45 days at our FXE Banyan facility.
- Pricing does not include any travel expenses if work is to be accomplished outside of Banyan Air Service facility unless stated in writing.
- Pricing does not include cost to remove and re-install the interior if required.
- Pricing does not include any fees (if required) from foreign government agencies for any approvals. This only applies if not US registered.
- At the conclusion of the above inspection, an estimate will be provided. The customer will have (3) three business days to address this estimate. At the end of the three days, if no decisions are made on the provided estimate, then storage fees will begin to accrue at our published rate.
- The prices quoted in this proposal represent a 3% discount for payment methods of cash, check, or wire transfer. This discount does not apply if paying by credit card.

Banyan's Payment Terms

- This proposal and the progressive payments that may be required are based on a cash, check, or wire transfer discount. This discount does not apply to payments made with a credit card.
- There will be a charge equaling 4% of the total labor added to your invoice to cover shop consumables.
- Banyan Air Services, Inc.'s policy requires a 50% deposit on all estimates over \$10,000.00 regardless of customer's terms, with an additional progress payment of 25% of estimated project total at the mid-point, with the balance due upon completion. Project growth may require additional progress payments depending on the estimated final balance due.



Date:	October 10, 2016	Aircraft:	KING AIR B200
Company:	GOBIERNO DEL ESTADO DE	Registration:	XC-CLQ
Contact:	ALBERTO SANTANA	Serial:	BB-1958
Phone:	59370521312300	Quoted By:	Carlos S. Orrego
Email:	SANTANA_ALBERTO@HOTMAIL.COM	Proposal ID:	13088
		Work Order:	050/37665/39416

MANDATORY APPROVED ITEMS: Y / N

Signature: _____

Authorized Company Representative: _____

Date of Acceptance: _____

RECOMMENDED APPROVED ITEMS: Y / N

Signature: _____

Authorized Company Representative: _____

Date of Acceptance: _____